


PROVENT ULTIMATE CATCH CAN

SERVICING / MAINTENANCE:

In addition to regular monitoring, the following maintenance is required:

- Drain every 5,000km or earlier.
- Replace element every 40,000km or when oil wetting appears around the catch can by-pass valve.

PROVENT ULTIMATE CATCH CAN (PV200) INTERNAL BYPASS VALVE SECTIONAL DIAGRAM

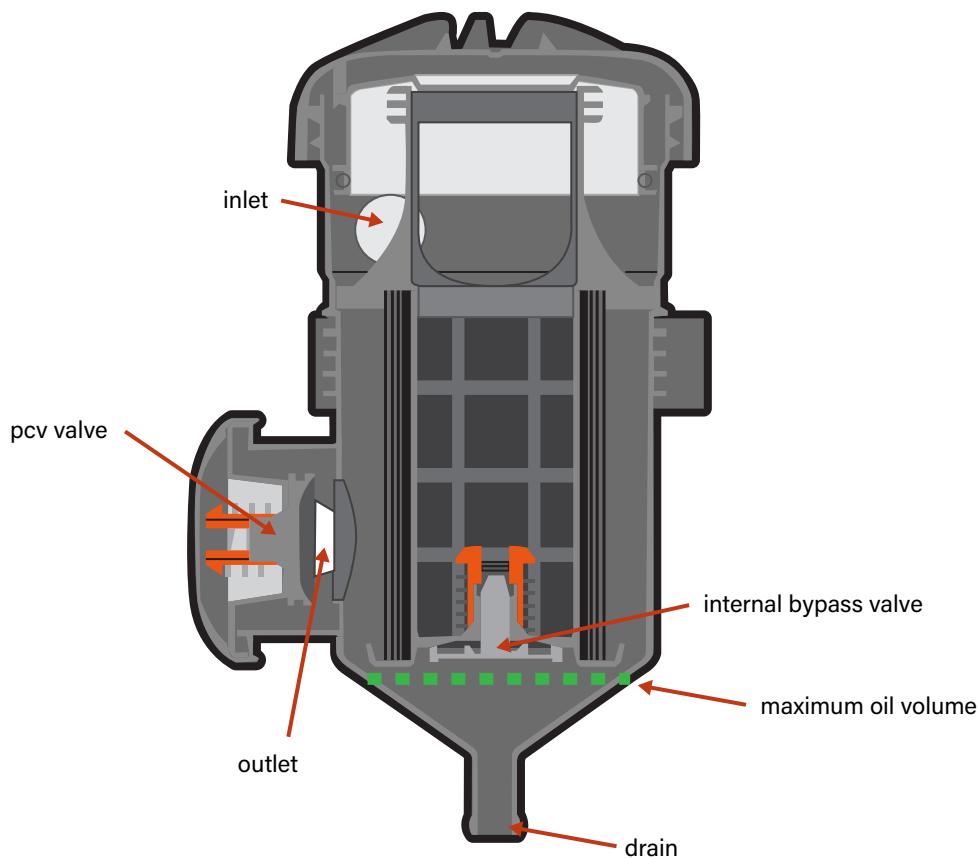

Due to the way the internally vented PV200 works, the PV200 must be drained regularly to ensure correct operation of the internal bypass valve. Failure to regularly draining/servicing the Catch Can may cause engine damage due to over pressurisation of the crankcase ventilation system.

The ■ ■ ■ in the diagram indicates the maximum permissible oil level. For the PV200 internal bypass valve to correctly operate the internal oil volume **MUST NOT** exceed the level indicated by the ■ ■ ■ shown in the diagram.

If the internal oil volume is to exceed the level indicated by the ■ ■ ■ shown in the diagram, the internal bypass valve cannot operate as designed due to it being submerged. This condition is likely to cause over pressurisation of the crankcase ventilation system and damaging the engine.

WARNING: Colder climates can cause increased condensation inside the Catch Can. This will fill the reservoir quicker than oil and will need to be drained regularly. Failure to do so could & can damaged the Catch Can or vehicle.